


Hex Washer Six-Lobe Serrated Pan Six-Lobe


HEAD DIMENSIONS

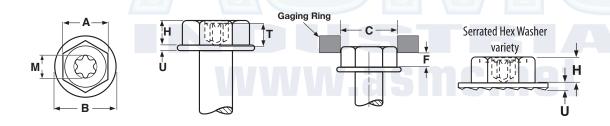

Nominal Size	A Width Across Flats		C Width Across Corners	H Head Height		B Washer Diameter		U Washer Thickness		M Recess Diameter	F Protrusion Beyond Gaging Ring	T Recess Penetration Gaging Depth		Six-Lobe Driver Size
	6	.250	.244	.272	.093	.080	.328	.302	.025	.015	.132	.048	.055	.045
8	.250	.244	.272	.110	.096	.348	.322	.031	.019	.155	.058	.070	.055	T20
10	.312	.305	.340	.120	.105	.414	.384	.031	.019	.178	.063	.075	.060	T25
12	.312	.305	.340	.155	.139	.432	.398	.039	.022	.200	.083	.085	.070	T27
14	.375	.367	.409	.190	.172	.520	.480	.050	.030	.221	.103	.100	.085	T30
1/4	.375	.367	.409	.190	.172	.520	.480	.050	.030	.221	.103	.100	.085	T30
5/16	.500	.489	.545	.230	.208	.676	.624	.055	.035	.266	.125	.120	.105	T40
3/8	.562	.551	.614	.295	.270	.780	.720	.063	.037	.312	.162	.145	.130	T45







SIX-LOBE SERRATED PAN HEADS										
Screw Size		D /		Н	R	G				
		Head Dir	mensions		8					
	Head D	Diameter	Head	Height	Ref	Gauge Penetration Min	(Fallaway) Max Penetration	Driver Size		
	Max	Min	Max	Min						
6	.270	.256	.097	.087	.132	.045	.026	T15		
8	.322	.306	.115	.105	S.155	.055	.031	T20		
10	.373	.357	.133	.122	.178	.070	.036	T25		
12	.425	.407	.151	.139	.200	.070	.040	T27		
1/4	.492	.473	.175	.162	.221	.085	.044	T30		