
## **SELF-DRILLING**

## Serrated Hex Washer, SPACED Thread

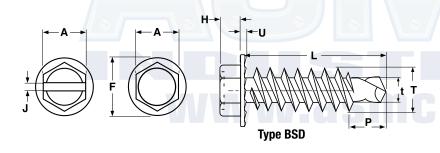


Serrated Hex Washer Self-Drilling Screws, Spaced Thread																	
Nominal	A Width Across Head		H Head Height		F Washer Diameter		U Washer Thickness		T Major Diameter		t Minor Diameter		Drill Point Size	Р			Recommended Screw Gun Speed
Screw Size & Threads														Protrusion			
per Inch	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Size	Allowance	Max	Min	Max RPM
6-20	.250	.244	.093	.080	.328	.302	.030	.019	.139	.135	.104	.099	2	.163	.090	.035	2500
8-18	.250	.244	.110	.096	.348	.322	.036	.024	.166	.161	.122	.116	2	.211	.100	.035	2500
10-16	.312	.305	.120	.105	.414	.384	036	.024	.189	.183	.141	.135	2	.235	.110	.035	2500
1/4-14	.375	.367	.190	.172	.520	.480	.050	.030	.246	.240	.192	.185	3	.393	.220	.110	2000
1/4-14	.438	.428	.190	.172	.590	.551	.050	.029	.246	.240	.192	.185	3	.393	.220	.110	2000
5/16-12	.438	.428	.230	.208	.590	.551	.050	.029	.315	.307	.272	.263	4	-	.312	.110	2000
5/16-12	.500	.489	.230	.208	.676	.624	.055	.035	.315	.307	.272	.263	3	-	.312	.110	2000

1/4 & 5/16" diameters are available with multiple head dimension configurations.

Description	An integrally formed hex washer head screw with serrations on the bearing surface side of the washer face and a drill point. Serrations extend from outer edge of washer face to the screw shank. Thread design is spaced (like a type-BSD drill screw).								
Applications/ Advantages	Used to attach plywood, soft wood or metal to metal. Serrated washer design adds greater holding power to components subject to vibrations caused by repeated movements. The 1/4-inch diameter screws, for instance, are commonly used to attach reinforcing strut or L-angle to garage doors.								
Material	AISI 1016 - 1024 or equivalent steel								
Heat Treatment	Fasteners are heat treated in a carbonitriding or gas-carburizing system at a minimum temperature of 625°F, or in a cyaniding system (with consent of the buyer) at a minimum temperature of 450°F.								
Case Hardness	Rockwell C 52 - 58								
Case Depth	#6 Diameter: .002007 #8 thru #12 Diameters: .004009 1/4" Diameter & larger: .005011								
Core Hardness	Rockwell C32 - 40								
Minimum Torsional Strength for ZINC- plated screws	#8 diameter: 41 lbin. #10 diameter: 55 lbin. 1/4" diameter: 132 lbin. 5/16" diameter: (no industry standard)								
Plating	Serrated hex washer self-drilling screws are usually supplied with a clear zinc finish.								

## **SELF-DRILLING**

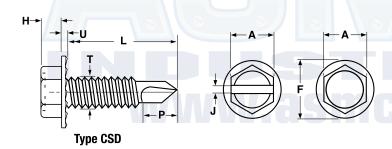

Serrated Hex Washer Self-Drilling Screws, Machine Screw Thread															
Nominal	A Width Across Head		H Head Height		F Washer Diameter		U Washer Thickness		T Major Diameter		Drill Point Size	Р	Drilling Thickness		Recommended Screw Gun Speed
Screw Size & Threads												Protrusion			
per Inch	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Size	Allowance	Max	Min	Max RPM
8-32	.250	.244	.110	.096	.348	.322	.036	.024	.163	.157	2	.162	.100		2500
Λ	.312	.305	.120	.105	.414	.384	036	.024	.189	.181	2	.193	.110		2500
10-24											3	.258	.175	.110	2500
10-32	.312	.305	.120	.105	.414	.384	036	.024	.189	.183	3	.258	.175	.110	2500
12-24	.312	.305	.155	.139	.432	.398	.029	.022	.215	.207	3	.293	.210	.110	2500
1/4-20	.375	.367	.190	.172	.590	.551	.063	.029	.250	.242	3	.350	.220	.110	2000
1/4-20	.438	.428	.190	.172	.610	.580	.063	.037	.250	.242	2	.275	.175	.035	2000
5/16-18	.438	.428	.229	.208	.610	.580	.063	.037	.315	.307	3	.421	_	_	

1/4" diameter is available with multiple head dimension configurations.

	u .								
Description	An integrally formed hex washer head screw with serrations on the bearing surface side of the washer face and a drill point. Serrations extend from outer edge of washer face to the screw shank. Thread design is unified (type-CSD).								
Applications/ Advantages	Used to attach plywood, soft wood or metal to metal. Serrated washer design adds greater holding power to components subject to vibrations caused by repeated movements. The 1/4-inch diameter screws, for instance, are commonly used to attach reinforcing strut or L-angle to garage doors.								
Material	AISI 1016 - 1024 or equivalent steel								
Heat Treatment	Fasteners are heat treated in a carbonitriding or gas-carburizing system at a minimum temperature of 625°F, or in a cyaniding system (with consent of the buyer) at a minimum temperature of 450°F.								
Case Hardness	Rockwell C 52 - 58								
Case Depth	#8 thru #12 Diameters: .004009 1/4" Diameter & larger: .005011								
Core Hardness	Rockwell C32 - 40								
Minimum Torsional Strength for ZINC- plated screws	#8 diameter: 41 lbin. #10 diameter: 55 lbin. 1/4" diameter: 132 lbin.								
Plating	Serrated hex washer self-drilling screws are usually supplied with a clear zinc finish.								